



HIGH GRADE MATERIAL SEAL KIT

高級材質シールキット

HIGH SEALING TECHNOLOGY

## **TOMOHI Seal Kit List.**

**Excavator etc. Cylinder Seal Kit**

KOMATSU ➤	PC—HD—WA—D—GD
HITACHI ➤	EX—ZX—UH
KOBELCO ➤	SK
KATO ➤	HD
SUMITOMO ➤	SH—LS
CAT ➤	MM—MS—E
VOLVO	
HYUNDAI	

**TOMOHI JAPAN**

[www.tomohi.jp](http://www.tomohi.jp)



**HIGH SEALING TECHNOLOGY  
CYLINDER REPAIR SEAL KIT**




**HIGH GRADE**

Made in Japan

**[www.tomohi.jp](http://www.tomohi.jp)**  
**Made in Japan**



# CYLINDER SEAL KIT in EXCVATOR and etc.

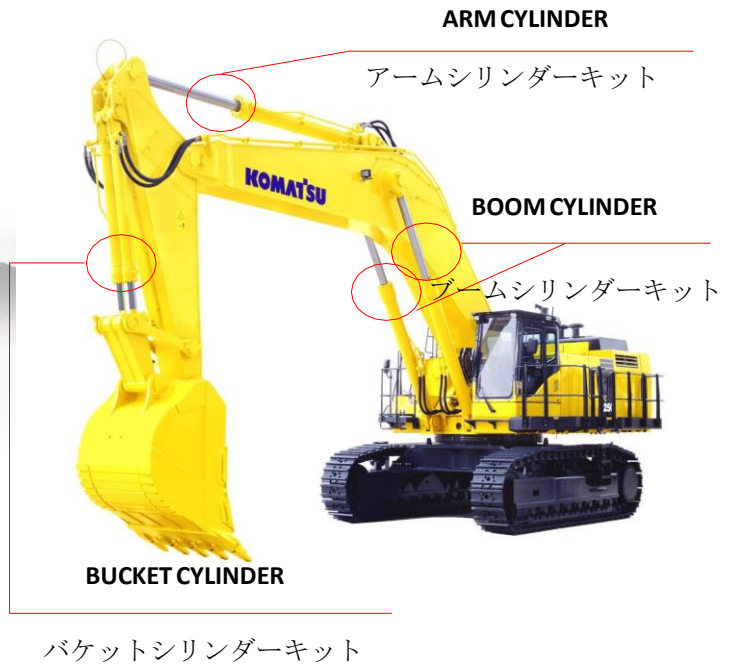

# EQUIPMENT




# TOMOHI SEAL KIT



[www.tomohi.jp](http://www.tomohi.jp)



# 油圧式パワーショベルの各部名称

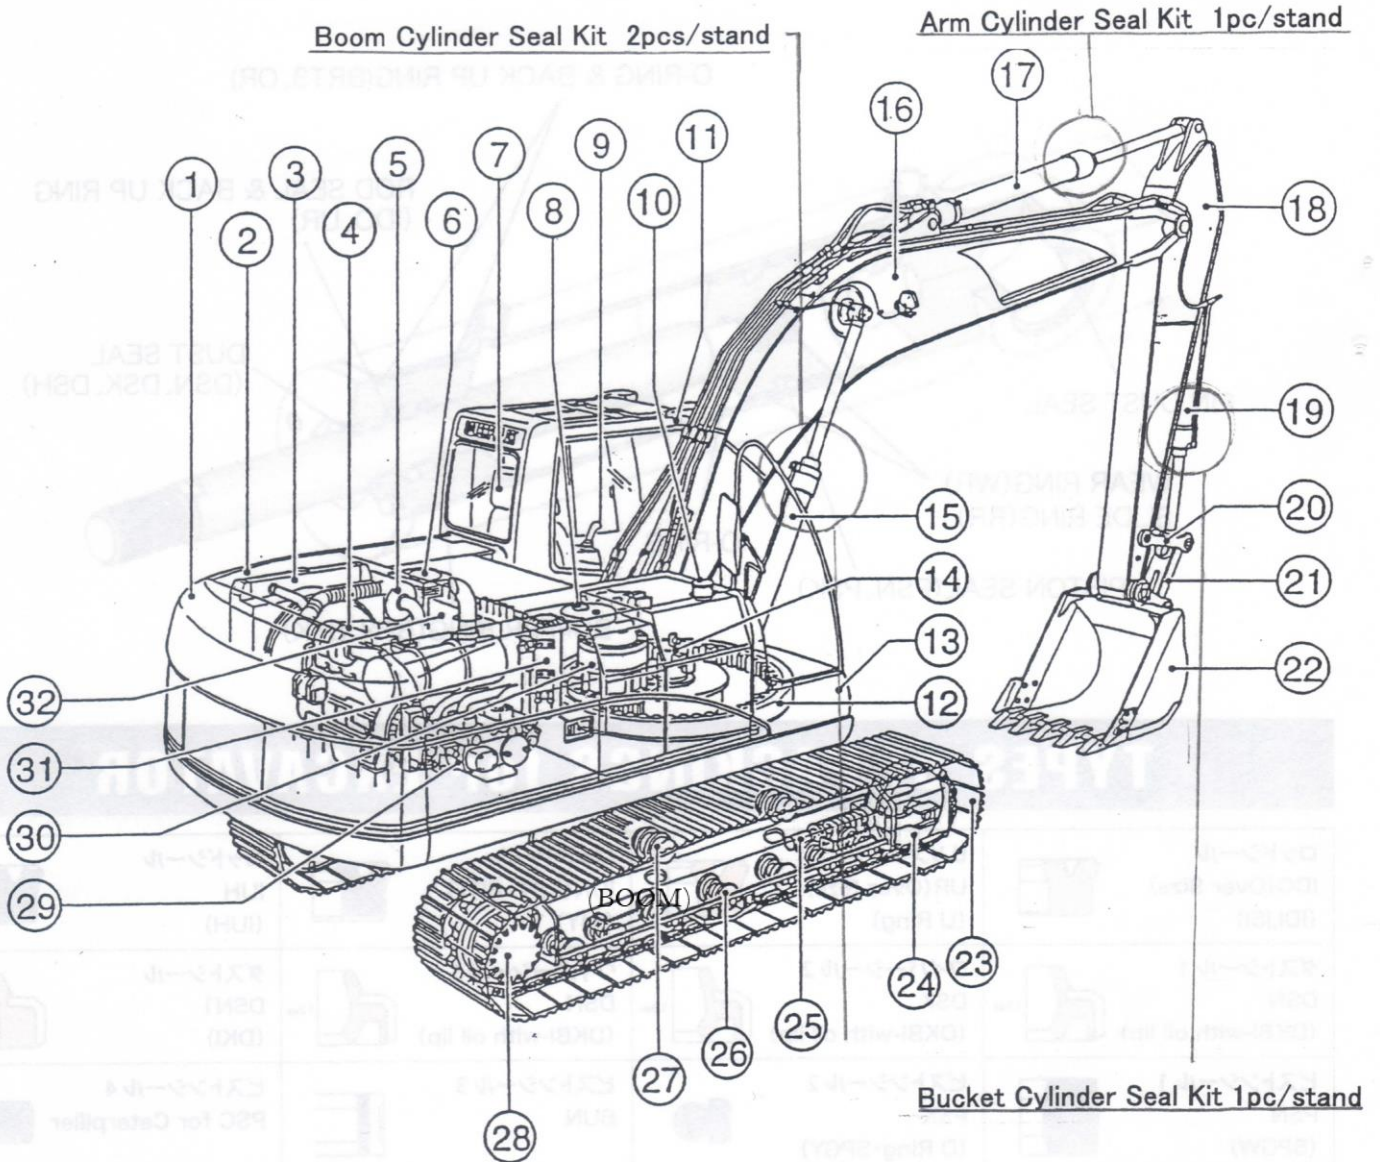


- ① カウンタウエイト
- ② エンジン カバー
- ③ ラジエータ&オイル クーラ
- ④ エンジン
- ⑤ エア クリーナ
- ⑥ バッテリ
- ⑦ オペレータ シート
- ⑧ ハイドロリック タンク
- ⑨ コントロール レバー
- ⑩ フュエル タンク
- ⑪ キャブ

- ⑫ スイング ベアリング
- ⑬ ストレージ ボックス
- ⑭ スイベル ジョイント
- ⑮ ブーム シリンダ (BOOM)
- ⑯ アーム シリンダ (Arm)
- ⑰ アーム (Arm)
- ⑱ バケット シリンダ (Bucket)
- ⑳ リンク
- ㉑ ロッド
- ㉒ バケット

- ㉓ トラック
- ㉔ アイドラ
- ㉕ トラック アジャスタ
- ㉖ トラック ローラ
- ㉗ キャリヤ ローラ
- ㉘ ファイナル ドライブ
- ㉙ ポンプ
- ㉚ スイング ドライブ
- ㉛ カプセル フィルタ
- ㉜ コントロール バルブ




# APPLICATION EXAMPLE for HYDRAULIC CYLINDER

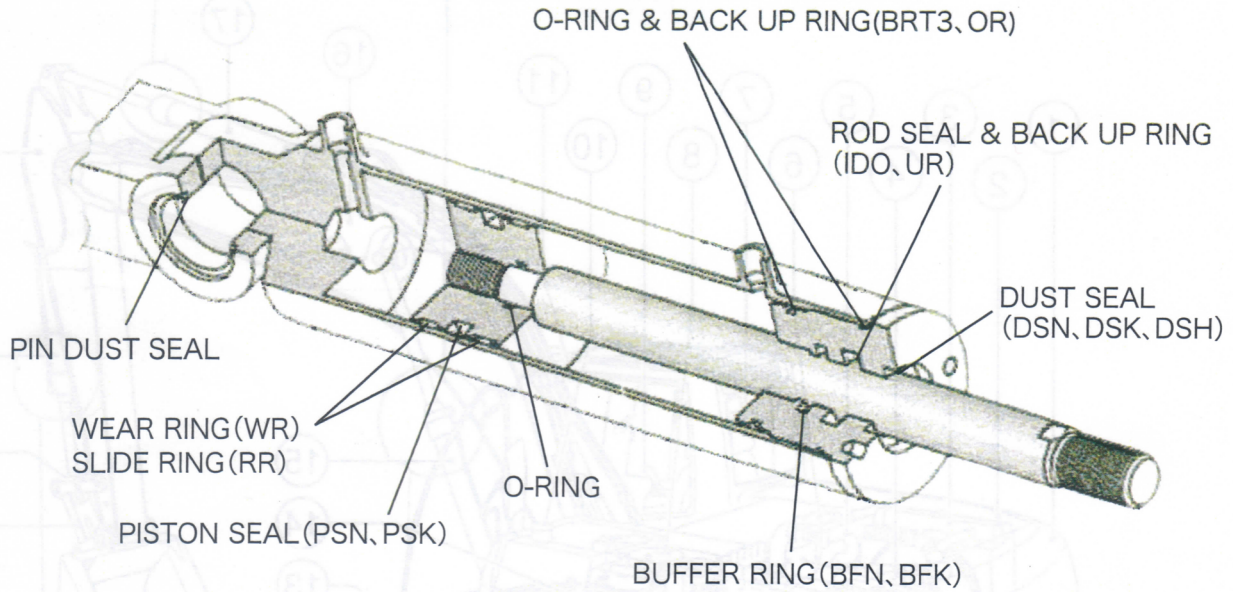

## TYPES of PACKINGS for EXCAVATOR

ロッドシール IDO (Over Size) (IDI, ISI)		U リング UR (Over Size) (U Ring)		ロッドシール IUN (IUH+BRT) (IUY)		ロッドシール IUH (IUH)	
ダストシール 1 DSN (DKBI-with oil lip)		ワイパーシール 2 DSK (DKBI-with oil lip)		ワイパーシール 3 DSH (DKBI-with oil lip)		ダストシール DSN1 (DKI)	
ピストンシール 1 PSN (SPGW)		ピストンシール 2 PSK (D Ring・SPGY)		ピストンシール 3 BUN		ピストンシール 4 PSC for Caterpillar	
バッファリング 1 BFN (HBY)		バッファリング 2 BFK (SRH45B)		バッファリング 3 BFO (HBTS)		ウェアリング 1 WR (茶色 FB)	
ウェアリング 2 WR (グレイ FG)		スライドリング SR (KZT)		バックアップリング (Oリング用) BRT P & G (PTFE)		バックアップリング (ピストン用) BRNG (Green)	
バックアップリング (ロット用) BRT BRN (Bz40) (MOS2)		O リング OR 1BP OR 1BG (NBR 90)		クッションシール CS		ロッドリング RR	

## EXCAVATOR REPAIR PACKINGS

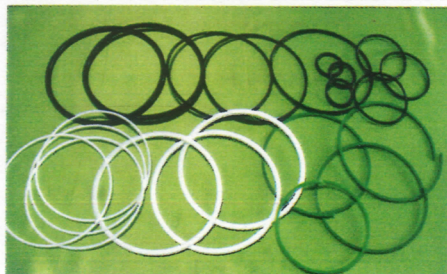



EX40UR-3		
Type	Part No	Rod/Buffer
Boom		○50659/-
Arm	UNKNOWN.	○45609/-
Bucket		○40559/-

EX45-1		
Type	Part No	Rod/Buffer
Boom		○608012/-
Arm	UNKNOWN.	○557512/-
Bucket		○50659/-

EX45-2		
Type	Part No	Rod/Buffer
Boom		○608012/-
Arm	UNKNOWN.	○557512/-
Bucket		○50659/-

EX50-1		
Type	Part No	Rod/Buffer
Boom	465821	○65809/HBY
Arm	426522	○55709/HBY
Bucket	426523	○50659/HBY
OFFSET		○50659/HBY

EX50U-1		
Type	Part No	Rod/Buffer
Boom		○557512/-
Arm	UNKNOWN.	○50659/-
Bucket		○45609/-

EX50UR-1		
Type	Part No	Rod/Buffer
Boom	4340243	○608012/-
Arm	4340250	○557512/-
Bucket	4340253	○507012/-
Offset	4340256	○507012/-

EX55UR-1/2		
Type	Part No	Rod/Buffer
Boom	4340243	○608012/-
Arm	4340250	○557512/-
Bucket	4340253	○507012/-
Offset	4340256	○507012/-

EX55UR-3		
Type	Part No	Rod/Buffer
Boom	732708	○608012/-
Arm	732808	○557512/-
Bucket	732905	○507012/-

EX58MU		
Type	Part No	Rod/Buffer
Boom	4340243	○608012/-
Arm	4340250	○557512/-
Bucket	4340253	○507012/-
Offset	4340256	○507012/-

EX60-1		
Type	Part No	Rod/Buffer
Boom	4217002	○65809/HBY
Arm	4217003	○60759/HBY
Bucket	4217004	○55709/HBY

EX60-2/3		EX60WD-2
Type	Part No	Rod/Buffer
Boom	4306444/4324883	○65809/HBY
Arm	4306445/4324884	○60759/HBY
Bucket	4306446/4324885	○55709/HBY

EX60UR-1/2		
Type	Part No	Rod/Buffer
Boom	4246123	○70859/HBY
Arm	4246124	60759/HBY
Bucket	4217004	○55709/HBY
Offset	4246125	

EX60-5		
Type	Part No	Rod/Buffer
Boom	4369762	○65809/HBY
Arm	4369718	○60759/HBY
Bucket	4369716	○55709/HBY
BLADE	4399105	○708310/HBY

EX75-1		EX60-5/EX75 UR/US
Type	Part No	Rod/Buffer
Boom	4369762	○65809/HBY
Arm	4369718	○60759/HBY
Bucket	4369716	○55709/HBY

EX60WD-2		
Type	Part No	Rod/Buffer
Boom	4306444/4324883	○65809/HBY
Arm	4306445/4324884	○60759/HBY
Bucket	4306446/4324885	○55709/HBY

EX75 UR/US		
Type	Part No	Rod/Buffer
Boom	4369762	○65809/HBY
Arm	4369718	○60759/HBY
Bucket	4369716	○55709/HBY

EX75UR-1		
Type	Part No	Rod/Buffer
Boom	4369768	○70859/HBY
Arm	4369763	○65809/HBY
Bucket	4369716	○55709/HBY

EX75UR-3		
Type	Part No	Rod/Buffer
Boom	4369768	○70859/HBY
Arm	4369763	○65809/HBY
Bucket	4369716	○55709/HBY

EX75 UR-3.5		
Type	Part No	Rod/Buffer
Boom	4369768	○70859/HBY
Arm	4369763	○65809/HBY
Bucket	4369716	○55709/HBY

EX75 US-3.5		
Type	Part No	Rod/Buffer
Boom	4369768	○70859/HBY
Arm	4369763	○65809/HBY
Bucket	4369716	○55709/HBY

EX75UR-5		
Type	Part No	Rod/Buffer
Boom	4441346	○75909/HBY
Arm	4369763	○65809/HBY
Bucket	4369716	○55709/HBY

EX90-1		
Type	Part No	Rod/Buffer
Boom	4216514	○65809/HBY
Arm	4216515	○70859/HBY
Bucket	4216516	○60759/HBY

EX100-1		EX120-1 OLD
Type	Part No	Rod/Buffer
Boom	4206340	○70859/HBY
Arm	4206343	○75909/HBY
Bucket	4206345	○65809/HBY

EX100WD-1		
Type	Part No	Rod/Buffer
Boom	4206340	○70859/HBY
Arm	4206343	○75909/HBY
Bucket	4206345	○65809/HBY

EX100WD-2		
Type	Part No	Rod/Buffer
Boom		
Arm	4286770/4320987	75909/HBY
Bucket		

EX100-2/3		
Type	Part No	Rod/Buffer
Boom	4286743/4320996	○70859/HBY
Arm	4286770/4320997	○75909/HBY
Bucket	4286739/4320994	○65809/HBY

EX100-5		
Type	Part No	Rod/Buffer
Boom	4379260	○70859/HBY
Arm	4379261	○75909/HBY
Bucket	4364914	○65809/HBY



EX120-1 (Old)			EX100-1			EX120-1 (New)			EX120-2/3/5			EX120K					
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer			
Boom	4206340	○70859/HBY	Boom	4206340	○70859/HBY	Boom	4206343	○75909/HBY	Boom	4286459/4320990	○70859/HBY	Boom	4286459/4320990	○70859/HBY			
Arm	4206343	○75909/HBY	Arm	4206343	○75909/HBY	Arm	4206344	○80959/HBY	Arm	4286463/4320993	○80959/HBY	Arm	4286463/4320993	○80959/HBY			
Bucket	4206345	○65809/HBY	Bucket	4206345	○65809/HBY	Bucket	4206345	○65809/HBY	Bucket	4286739/4320994	○65809/HBY	Bucket	4286739/4320994	○65809/HBY			
EX120K			EX120-2/3			EX120-5			EX130L-5/EX135UR-1			EX130K			EX120-2/3		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	4286459/4320990	○70859/HBY	Boom	4286459/4320990	○70859/HBY	Boom	4364912	○70859/HBY	Boom	4364912	○70859/HBY	Boom	4286459/4320990	○70859/HBY	Boom	4286459/4320990	○70859/HBY
Arm	4286463/4320993	○80959/HBY	Arm	4286463/4320993	○80959/HBY	Arm	4364913	○80959/HBY	Arm	4364913	○80959/HBY	Arm	4286463/4320993	○80959/HBY	Arm	4286463/4320993	○80959/HBY
Bucket	4286739/4320994	○65809/HBY	Bucket	4286739/4320994	○65809/HBY	Bucket	4364914	○65809/HBY	Bucket	4364914	○65809/HBY	Bucket	4286739/4320994	○65809/HBY	Bucket	4286739/4320994	○65809/HBY
EX130L-5			EX120-5/EX135UR-1			EX135UR-1			EX120-5/EX130L-5			EX135USR-1			EX120-5/EX130L-5		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	4364912	○70859/HBY	Boom	4364912	○70859/HBY	Boom	4364912	○70859/HBY	Boom	4364912	○70859/HBY	Boom	4364912	○70859/HBY	Boom	4364912	○70859/HBY
Arm	4364913	○80959/HBY	Arm	4364913	○80959/HBY	Arm	4364913	○80959/HBY	Arm	4364913	○80959/HBY	Arm	4364913	○80959/HBY	Arm	4364913	○80959/HBY
Bucket	4364914	○65809/HBY	Bucket	4364914	○65809/HBY	Bucket	4364914	○65809/HBY	Bucket	4364914	○65809/HBY	Bucket	4364914	○65809/HBY	Bucket	4364914	○65809/HBY
EX135 US/USR			EX135UR-5			EX135UR-5			EX135US-5			EX135US-5			EX135US-5		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	4448395	75909/HBY	Boom	UNKNOWN	—	Boom	UNKNOWN	—	Boom	364912	○70859/HBY	Boom	364912	○70859/HBY	Boom	364912	○70859/HBY
Arm	4448396	80959/HBY	Arm	UNKNOWN	○851009/HBY	Arm	UNKNOWN	○851009/HBY	Arm	UNKNOWN	○80959/HBY	Arm	UNKNOWN	○80959/HBY	Arm	UNKNOWN	○80959/HBY
Bucket	4448397	70859/HBY	Bucket	UNKNOWN	—	Bucket	UNKNOWN	—	Bucket	UNKNOWN	○65809/HBY	Bucket	UNKNOWN	○65809/HBY	Bucket	UNKNOWN	○65809/HBY
EX150-1			EX160WD			EX160WD			EX150-1			EX200-1			EX200-1		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	4216263/4369893	○80959/HBY	Boom	4216263/4369893	○80959/HBY	Boom	4216263/4369893	○80959/HBY	Boom	4216263/4369893	○80959/HBY	Boom	4153209	○851009/HBY	Boom	4153209	○851009/HBY
Arm	4216264	○851009/HBY	Arm	4216264	○851009/HBY	Arm	4216264	○851009/HBY	Arm	4216264	○851009/HBY	Arm	4153211	○10012012/HBY	Arm	4153211	○10012012/HBY
Bucket	4216263/4286739	○80959/HBY	Bucket	4216263/4286739	○80959/HBY	Bucket	4216263/4286739	○80959/HBY	Bucket	4216263/4286739	○80959/HBY	Bucket	4153213	○80959/HBY	Bucket	4153213	○80959/HBY
EX200-1			EX200-1 New			EX200-1 New			EX200-2/3			EX200-2/3			EX200-2/3		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	4364915	○851009/HBY	Boom	4206018	○851009/HBY	Boom	4206018	○851009/HBY	Boom	4286774/4364915	○851009/HBY	Boom	4286774/4364915	○851009/HBY	Boom	4286774/4364915	○851009/HBY
Arm	4364916	○951109/HBY	Arm	4206019	○9511512/HBY	Arm	4206019	○9511512/HBY	Arm	4364916	○9511512/HBY	Arm	4286780	○9511512/HBY	Arm	4286780	○9511512/HBY
Bucket	4364917	○75909/HBY	Bucket	4206020	○80959/HBY	Bucket	4206020	○80959/HBY	Bucket	4364917	○75909/HBY	Bucket	4286784/4364917	○75909/HBY	Bucket	4286784/4364917	○75909/HBY
EX200-2/3			NEW			EX200-5/5E			EX200-5/5E			EX200-6/7			EX200-7		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	4320999	○851009/HBY	Boom	4320999	○851009/HBY	Boom	4364915	○851009/HBY	Boom	4364915	○851009/HBY	Boom	4448398/4654421	○851009/HBY	Boom	4448398/4654421	○851009/HBY
Arm	4316625	○9511512/HBY	Arm	4316625	○9511512/HBY	Arm	4364916	○951109/HBY	Arm	4364916	○951109/HBY	Arm	4448399/4654422	○951109/HBY	Arm	4448399/4654422	○951109/HBY
Bucket	4321000	○75909/HBY	Bucket	4321000	○75909/HBY	Bucket	4364917	○75909/HBY	Bucket	4364917	○75909/HBY	Bucket	4448400/1102306	○80959/HBY	Bucket	4448400/1102306	○80959/HBY
EX210H			EX210K-5			EX210K-5			EX210LCH-5			EX210LCH-5			EX210LCH-5		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	4364915	○851009/HBY	Boom	4364915	○851009/HBY	Boom	4364915	○851009/HBY	Boom	4364915	○851009/HBY	Boom	4364915	○851009/HBY	Boom	4364915	○851009/HBY
Arm	4364916	○951109/HBY	Arm	4364916	○951109/HBY	Arm	4364916	○951109/HBY	Arm	4364916	○951109/HBY	Arm	4364916	○951109/HBY	Arm	4364916	○951109/HBY
Bucket	4364917	○75909/HBY	Bucket	4364917	○75909/HBY	Bucket	4426669	○IUY85/HBY	Bucket	4364917	○75909/HBY	Bucket	4364917	○75909/HBY	Bucket	4364917	○75909/HBY
EX220-1/230-1			EX220-2/3			EX220-2/3			EX220-5			EX220-2/3			EX220-5		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	4203830	○901059/HBY	Boom	9103842	○901059/HBY	Boom	9103842	○901059/HBY	Boom	9103842/9144507	○901059/HBY	Boom	9103842/9144507	○901059/HBY	Boom	9103842/9144507	○901059/HBY
Arm	4203831	○1001159/HBY	Arm	9103843	○1001159/HBY	Arm	9103843	○1001159/HBY	Arm	9103843/9156441	○1001159/HBY	Arm	9103843/9156441	○1001159/HBY	Arm	9103843/9156441	○1001159/HBY
Bucket	4203830	○901059/HBY	Bucket	9103844	○901059/HBY	Bucket	9103844	○901059/HBY	Bucket	9103844/9144508	○901059/HBY	Bucket	9103844/9144508	○901059/HBY	Bucket	9103844/9144508	○901059/HBY



EX220(LC)-5			EX220-6			EX225USR LCK		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	9178283	○IUUY90/HBY	Boom	9144507/9165334	○IUUY90/HBY	Boom		
Arm	9178284	○IUUY100/HBY	Arm	9159327/9165336	○IUUY100/HBY	Arm		
Bucket	9178294	○IUUY85/HBY	Bucket	9144508/9165336	○IUUY85/HBY	Bucket	4426669	○IUUY85/HBY

EX225US			EX225USR.			EX230-1/220-1		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	4364915/4661485	○851009/HBY	Boom	4364915/4661485	○851009/HBY	Boom	4203830	○901059/HBY
Arm	4364916	○951109/HBY	Arm	4364916	○951109/HBY	Arm	4203831	○1001159/HBY
Bucket	4364917	○75909/HBY	Bucket	4364917	○75909/HBY	Bucket	4203830	○901059/HBY

EX270-1			EX270-5			EX280-5		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	9078843	○951109/HBY	Boom	9180587	○951109/HBY	Boom	9180587	○951109/HBY
Arm	9078844	○1051209/HBY	Arm	9180579	○1001159/HBY	Arm	9180579	○1001159/HBY
Bucket	9078843	○951109/HBY	Bucket	9180580	○951109/HBY	Bucket	9180580	○951109/HBY

EX280H-5			280LCH-5			EX300-1/2		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	9180587	○951109/HBY	Boom	9180587	○951109/HBY	Boom	9078845/9122616	○1001159/HBY
Arm	9180579	○1001159/HBY	Arm	9180579	○1001159/HBY	Arm	9078846/9123264	○1101259/HBY
Bucket	9180580	○951109/HBY	Bucket	9180580	○951109/HBY	Bucket	9078843/9123265	○951109/HBY

耐熱材 EX300(LC)-1			EX300-2/3			EX300-5 EX300-1/2		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	9180581	IUH105/HBY	Boom	9123263	○1001159/HBY	Boom	9078845/9123263	○1001159/HBY
Arm	9180582	IUH110/HBY	Arm	9123264	○1101259/HBY	Arm	9078846/9123264	○1101259/HBY
Bucket	9175564	IUH95/HBY	Bucket	9123265	○951109/HBY	Bucket	9078843/9123265	○951109/HBY

EX310-1			EX310-3 EX300-1/2			EX310LCH-3C EX300-1/2		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	9180581	1051209/HBY	Boom	9078845	○1001159/HBY	Boom	9078845	○1001159/HBY
Arm	9180582	1101259/HBY	Arm	9078846	○1101259/HBY	Arm	9078846	○1101259/HBY
Bucket	9175564	951109/HBY	T5	9078843	○951109/HBY	T5	9078843	○951109/HBY

EX310H EX300-1/2			EX320-1 X300-1/2 EX310-3/EX330-1			EX330-1 EX300-1/EX310-3/EX320-1		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	9078845	○1001159/HBY	Boom	9078845	○1001159/HBY	Boom	9078845/9123263	○1001159/HBY
Arm	9078846	○1101259/HBY	Arm	9078846	○1101259/HBY	Arm	9078846/9123264	○1101259/HBY
Bucket	9078843	○951109/HBY	Bucket	9078843	○951109/HBY	Bucket	9078843/9123265	○951109/HBY

EX350-1 EX310-1			耐熱材 EX350H			耐熱材 EX350LCH		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	9180581	IUH1051209/HBY	Boom	9180581	IUH105/HBY	Boom	9180581	IUH105/HBY
Arm	9180582	IUH1101259/HBY	Arm	9180582	IUH110/HBY	Arm	9180582	IUH110/HBY
Bucket	9175564	IUH951109/HBY	Bucket	9175564	IUH95/HBY	Bucket	9175564	IUH95/HBY

耐熱材 EX350K			耐熱材 EX350LCK			EX350LCK-3		
Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer	Type	Part No	Rod/Buffer
Boom	9180581	IUH105/HBY	Boom	9180581	IUH105/HBY	Boom		
Arm	9180582	IUH110/HBY	Arm	9180582	IUH110/HBY	Arm		
Bucket	9175564	IUH95/HBY	Bucket	9175564	IUH95/HBY	Bucket		9511512/HBY



耐熱材 EX350LCK-5		
Type	Part No	Rod/Buffer
Boom	9180581	IUH105/HBY
Arm	9180582	IUH110/HBY
Bucket	9175564	IUH95/HBY

EX370-1 EX310-1		
Type	Part No	Rod/Buffer
Boom	9180581	IUH105/HBY
Arm	9180582	IUH110/HBY
Bucket	9175564	IUH95/HBY

EX370HD-1		
Type	Part No	Rod/Buffer
Boom	9180581	IUH105/HBY
Arm	9180582	IUH110/HBY
Bucket	9175564	IUH95/HBY

EX370-5 EX310-1/EX350-1		
Type	Part No	Rod/Buffer
Boom	9180581	IUH1051209/HBY
Arm	9180582	1101259/HBY
Bucket	9175564	951109/HBY

EX370HD-5 EX310-1/EX350-1		
Type	Part No	Rod/Buffer
Boom	9180581	IUH1051209/HBY
Arm	9180582	1101259/HBY
Bucket	9175564	951109/HBY

EX400-1/2 EX450-1		
Type	Part No	Rod/Buffer
Boom	4438672/4236057	○11513512/HBY
Arm	4340621/4236058	○13015012/HBY
Bucket	4340620/4236057	○11513512/HBY

EX400-3 EX450-5		
Type	Part No	Rod/Buffer
Boom	4340620	○11513512/HBY
Arm	4340621	○13015012/HBY
Bucket	4340620	○11513512/HBY

EX400-5		
Type	Part No	Rod/Buffer
Boom	4438672	○11513512/HBY
Arm	4438679	○13015012/HBY
Bucket	4438672	○11513512/HBY

EX450-1 EX400-1/2		
Type	Part No	Rod/Buffer
Boom	4236057/4438672	○11513512/HBY
Arm	4236058/4340621	○13015012/HBY
Bucket	4236057/4340620	○11513512/HBY

EX450-5 EX400-5		
Type	Part No	Rod/Buffer
Boom	4340620	○11513512/HBY
Arm	4340621	○13015012/HBY
Bucket	4340620	○11513512/HBY

EX450-7		
Type	Part No	Rod/Buffer
Boom		—
Arm	UNKNOWN	—
Bucket		○1001159/HBY

EX520-3		
Type	Part No	Rod/Buffer
Boom	4653040	—
Arm	4653041	—
Bucket	4653042	—

EX550-1		
Type	Part No	Rod/Buffer
Boom	4348853	—
Arm	4348854	—
Bucket	4348855	—

EX650-1		
Type	Part No	Rod/Buffer
Boom	4438682	—
Arm	4438684	—
Bucket	4438696	—

EX700 H		
Type	Part No	Rod/Buffer
Boom	4254041	—
Arm	4436496	—
Bucket	4256119	—

EX750-5		
Type	Part No	Rod/Buffer
Boom	4238684	—
Arm	4436496	—
Bucket	4437964	—

EX800-H5		
Type	Part No	Rod/Buffer
Boom	43911321	—
Arm	4436496	—
Bucket	4337109	—

EX1200-5		
Type	Part No	Rod/Buffer
Boom	4465641	—
Arm	4465632	—
Bucket	4465644	—

EX2500		
Type	Part No	Rod/Buffer
Boom	4407489	—
Arm	4407490	—
Bucket	4407494	—

Type	Part No	Rod/Buffer

Type	Part No	Rod/Buffer

EX3600-1		
Type	Part No	Rod/Buffer
Boom		IUY260 290 20/HBY
Arm	検討中	
Bucket		

EX3600-5		
Type	Part No	Rod/Buffer
Boom		
Arm	検討中	IUY 220 245 16/HBY
Bucket		
Loader		

EX3600-6 UH04-3		
Type	Part No	Rod/Buffer
Boom		
Arm	検討中	IUY220 245 16/HBY
Bucket		IUY180 205 16/HBY
Loader		IUY200 225 16/HBY

EX5500-5		
Type	Part No	Rod/Buffer
Boom		
Arm	検討中	
Bucket		IUY230 260 20/HBY

EX5500-5		
Type	Part No	Rod/Buffer
Level		IUY 160 180 12/HBY
Loder	検討中	IUY250 280 20/HBY

Type	Part No	Rod/Buffer
Boom		
Arm		
Bucket		



ZX27U-1		
Type	Part No	Rod/Buffer
Boom		○406012/-
Arm	UNKNOWN	○40559/-
Bucket		○35458/-

ZX27-2		
Type	Part No	Rod/Buffer
Boom		○456512/-
Arm	UNKNOWN	○406012/-
Bucket		○35458/-

ZX30-1		
Type	Part No	Rod/Buffer
Boom	4614056	○456512/-
Arm		
Bucket		

ZX30U-1		
Type	Part No	Rod/Buffer
Boom		○45609/-
Arm	UNKNOWN	○40559/-
Bucket		○40559/-

ZX30U-2/AX30U-4		
Type	Part No	Rod/Buffer
Boom	4652374	○456512/-
Arm	4634032	○406012/-
Bucket	4614058	○406012/-

ZX30UR-1/AX30UR-4		
Type	Part No	Rod/Buffer
Boom		○50659/-
Arm	UNKNOWN	○40559/-
Bucket		○35458/-

ZX30UR-2/AX30UR-5		
Type	Part No	Rod/Buffer
Boom	4652374	○507012/-
Arm	4634032	○406012/-
Bucket	4614058	○406012/-

ZX35U-1/AX35U-3		
Type	Part No	Rod/Buffer
Boom	850309	○45609/-
Arm	849304	○45609/-
Bucket	849503..	○40559/-

ZX35U-2/AX35U-4		
Type	Part No	Rod/Buffer
Boom	4634033	○507012/-
Arm	4634034	○456512/-
Bucket	4614058	○406012/-

ZX35U-3		
Type	Part No	Rod/Buffer
Boom	4634033	○507012/-
Arm	4704455	○456512/-
Bucket	4614058	○406012/-

ZX38U-1.		
Type	Part No	Rod/Buffer
Boom		
Arm	UNKNOWN	○456512/-
Bucket		

ZX40U-1/AX40U-3		
Type	Part No	Rod/Buffer
Boom	0843504/654216	○55709/-
Arm	0843613/656714	○50659/-
Bucket	658611	○40559/-

ZX40U-2/AX40U-4		
Type	Part No	Rod/Buffer
Boom		○557512/-
Arm	UNKNOWN	○507012/-
Bucket		○406012/-

ZX40UR-1/AX40U-4		
Type	Part No	Rod/Buffer
Boom		○50659/-
Arm	UNKNOWN	○45609/-
Bucket		○40559/-

ZX40UR-2/AX40UR-5		
Type	Part No	Rod/Buffer
Boom		○55709/-
Arm	UNKNOWN	○456512/-
Bucket		○406012/-

ZX48U-5A		
Type	Part No	Rod/Buffer
Boom	YD0000519-2	
Arm	YD0000519-3	
Bucket	YD0000519-4	

ZX50U-1		
Type	Part No	Rod/Buffer
Boom	844807	○557512/-
Arm	843613	○50659/-
Bucket	844705	○45609/-

ZX50U-2		
Type	Part No	Rod/Buffer
Boom	4634038	○557512/-
Arm	4634036	○507012/-
Bucket	4634037	○456512/-

ZX50U-3 2種あり		
Type	Part No	Rod/Buffer
Boom	4634038	○557512/-
Arm	4634036	○507012/-
Bucket	4614069	○456512/-

ZX55UR-1		
Type	Part No	Rod/Buffer
Boom	732708	○608012/-
Arm	732808	○557512/-
Bucket	4652380/732905	○507012/-

ZX55UR-2 030001-		
Type	Part No	Rod/Buffer
Boom	4652378	○608012/-
Arm	4652379	○557512/-
Bucket	4652380	○507012/-
Offset	4652381	○507012/-

ZX55UR-3		
Type	Part No	Rod/Buffer
Boom	4652378	○608012/-
Arm	4652379	○557512/-
Bucket	4652380	○507012/-
Offset	4652381	○507012/-

ZX70-1/ZX80-1		
Type	Part No	Rod/Buffer
Boom	4369762/4464984	○65809/HBY
Arm	4369718/4464985	○60759/HBY
Bucket	4369716/4464986	○55709/HBY

ZX75UR-1 ZX75US-1		
Type	Part No	Rod/Buffer
Boom	4369762/4464984	○65809/HBY
Arm	4369718/4464985	○60759/HBY
Bucket	4369716/4464986	○55709/HBY

ZX75US-A		
Type	Part No	Rod/Buffer
Boom	4369762/4464984	○65809/HBY
Arm	4369718/4464985	○60759/HBY
Bucket	4369716/4464986	○55709/HBY

ZX75US-1 ZX75-5 US/UR		
Type	Part No	Rod/Buffer
Boom	4369762/4464984	○65809/HBY
Arm	4369718/4464985	○60759/HBY
Bucket	4369716/4464986	○55709/HBY

ZX75US-3 060001-		
Type	Part No	Rod/Buffer
Boom	4663491	○65809/HBY
Arm	4464985	○60759/HBY
Bucket	4464986	○55709/HBY



ZX75-3 US/UR		
Type	Part No	Rod/Buffer
Boom	UNKNOWN	—
Arm	4369763	○65809/HBY
Bucket	UNKNOWN	—

ZX75-5 US/UR ZX75US-1		
Type	Part No	Rod/Buffer
Boom	4369762/4464984	○65809/HBY
Arm	4369718/4464985	○60759/HBY
Bucket	4369716/4464986	○55709/HBY

ZX75UR-5		
Type	Part No	Rod/Buffer
Boom	4441346	○75909/HBY
Arm	4415584	○60759/HBY
Bucket	4415585	○60759/HBY

ZX75US-5A		
Type	Part No	Rod/Buffer
Boom	4441346	○75909/HBY
Arm	4415584	○60759/HBY
Bucket	4415585	○60759/HBY

ZX80-1 ZX75US-1		
Type	Part No	Rod/Buffer
Boom	4369762/4464984	○65809/HBY
Arm	4369718/4464985	○60759/HBY
Bucket	4369716/4464986	○55709/HBY

ZX80LCK-1 ZX75US-1		
Type	Part No	Rod/Buffer
Boom	4369762/4464984	○65809/HBY
Arm	4369718/4464985	○60759/HBY
Bucket	4369716/4464986	○55709/HBY

ZX100-1 ZX110-1		
Type	Part No	Rod/Buffer
Boom	4448392	○70859/HBY
Arm	4448392	○75909/HBY
Bucket	4448394	○65809/HBY

ZX110-1 ZX100-1		
Type	Part No	Rod/Buffer
Boom	4448392	○70859/HBY
Arm	4448392	○75909/HBY
Bucket	4448394	○65809/HBY

ZX110-3		
Type	Part No	Rod/Buffer
Boom	4663495	○70859/HBY
Arm	4662893	○75909/HBY
Bucket	4662894	○65809/HBY

ZX120-1 ZX120-3		
Type	Part No	Rod/Buffer
Boom	4448395	○70859/HBY
Arm	4448396	○80959/HBY
Bucket	4448397	○70859/HBY

ZX120-3 ZX120-1		
Type	Part No	Rod/Buffer
Boom	4662895/4448395	○70859/HBY
Arm	4448396	80959/HBY
Bucket	4448397	○70859/HBY

ZX125-1		
Type	Part No	Rod/Buffer
Boom	4448395	○70859/HBY
Arm	4448396	○80959/HBY
Bucket	4448397	○70859/HBY

ZX125US/USE		
Type	Part No	Rod/Buffer
Boom	4448395	○70859/HBY
Arm	4448396	○80959/HBY
Bucket	4448397	○70859/HBY

ZX125W		
Type	Part No	Rod/Buffer
Boom	UNKNOWN	—
Arm	UNKNOWN	—
Bucket	4364914	○65809/HBY

ZX130-1 ZX120-1/ZX135K		
Type	Part No	Rod/Buffer
Boom	4448395	○70859/HBY
Arm	4448396	○80959/HBY
Bucket	4448397	○70859/HBY

ZX130K-3 ZX135US-3 same		
Type	Part No	Rod/Buffer
Boom	4662895	○70859/HBY
Arm	4669905	○80959/HBY
Bucket	4663496	○70859/HBY

ZX135K ZX130-1 same		
Type	Part No	Rod/Buffer
Boom	4448395	○70859/HBY
Arm	4448396	○80959/HBY
Bucket	4448397	○70859/HBY

ZX135UR-1		
Type	Part No	Rod/Buffer
Boom	4448395	○70859/HBY
Arm	4482921	○851009/HBY
Bucket	4448394	○65809/HBY

ZX135US-1 ZX120-1/ZX130-1		
Type	Part No	Rod/Buffer
Boom	4448395	○70859/HBY
Arm	4448396	○80959/HBY
Bucket	4448397	○70859/HBY
BLADE	4388027	70859/HBY

ZX135US-3 ZX130K-3 same		
Type	Part No	Rod/Buffer
Boom	4662895	○70859/HBY
Arm	4669905	○80959/HBY
Bucket	4663496	○70859/HBY

ZX135 US/UR ZX120-1/ZX130-1		
Type	Part No	Rod/Buffer
Boom	4364912/4448395	○70859/HBY
Arm	4448396	○80959/HBY
Bucket	4448397	○70859/HBY

ZX135 USR ZX120-1/ZX130-1		
Type	Part No	Rod/Buffer
Boom	4364912/4448395	○70859/HBY
Arm	4448396	○80959/HBY
Bucket	4448397	○70859/HBY

ZX160-1		
Type	Part No	Rod/Buffer
Boom	4467379	—
Arm	4467380	—
Bucket	4467381	—

ZX180-1		
Type	Part No	Rod/Buffer
Boom	4448398	○851009/HBY
Arm	4483194	—
Bucket	4467381	—

ZX200(LC)-1 ZX200-6/ZX200-7		
Type	Part No	Rod/Buffer
Boom	4448398/4654421	○851009/HBY
Arm	4448399/4654422	○951109/HBY
Bucket	4448400/1102306	○80959/HBY

ZX200(LC)-E ZX200-6/ZX200-7		
Type	Part No	Rod/Buffer
Boom	4448398/4654421	○851009/HBY
Arm	4448399/4654422	○951109/HBY
Bucket	4448400/1102306	○80959/HBY

ZX200-3 ZX200-6		
Type	Part No	Rod/Buffer
Boom	4661485/4654421	○851009/HBY
Arm	4448396/4654422	○951109/HBY
Bucket	4448400/1102306	○80959/HBY



ZX200-5G		
Type	Part No	Rod/Buffer
Boom	YA00001396	○851009/HBY
Arm	YA00001400	○951109/HBY
Bucket	YA00001392	○80959/HBY

ZX200-5G/210LC-5G		
Type	Part No	Rod/Buffer
Boom	YA00001396	○851009/HBY
Arm	YA00001400	○951109/HBY
Bucket	YA00001392	○80959/HBY

ZX200-6 <small>ZX200-1/ZX200-3/ZX200-7</small>		
Type	Part No	Rod/Buffer
Boom	4448398/4654421	○851009/HBY
Arm	4448399/4654422	○951109/HBY
Bucket	4448400/1102306	○80959/HBY

Type	Part No	Rod/Buffer
Boom		
Arm		
Bucket		

ZX200-7 <small>ZX200-1/ZX200-3/ZX200-6</small>		
Type	Part No	Rod/Buffer
Boom	4448398/4654421	○851009/HBY
Arm	4448399/4654422	○951109/HBY
Bucket	4448400/1102306	○80959/HBY

ZX210(LC)-1 <small>ZX200-3/ZX200-7</small>		
Type	Part No	Rod/Buffer
Boom	4448398/4661485	○851009/HBY
Arm	4448399/4661594	○951109/HBY
Bucket	4448400/4654423	○80959/HBY

ZX210H/LCH <small>ZX200-3/ZX200-7</small>		
Type	Part No	Rod/Buffer
Boom	4448398/4661485	○851009/HBY
Arm	4448399/4661594	○951109/HBY
Bucket	4448400/4654423	○80959/HBY

ZX210K/LCK <small>ZX200-3/ZX200-7</small>		
Type	Part No	Rod/Buffer
Boom	4448398/4661485	○851009/HBY
Arm	4448399/4661594	○951109/HBY
Bucket	4448400/1102306	○80959/HBY

ZX210N <small>ZX200-3/ZX200-7</small>		
Type	Part No	Rod/Buffer
Boom	4448398/4661485	○851009/HBY
Arm	4448399/4661594	○951109/HBY
Bucket	4448400/1102306	○80959/HBY

ZX210N		
Type	Part No	Rod/Buffer
Boom	4661661	○1051209/HBY
Arm	4448399/4661594	○951109/HBY
Bucket	4411535	○80959/HBY

ZX210-3 <small>ZX200-3/ZX200-7</small>		
Type	Part No	Rod/Buffer
Boom	4661485/4654421	○851009/HBY
Arm	4654422/4654422	○951109/HBY
Bucket	1102306/4448397	○80959/HBY

ZX210K-3		
Type	Part No	Rod/Buffer
Boom	4654421	○851009/HBY
Arm	4654422	○951109/HBY
Bucket	1102407	○851009/HBY

ZX210LCK-3		
Type	Part No	Rod/Buffer
Boom	4654421	○851009/HBY
Arm	4654422	○951109/HBY
Bucket	1102407	○851009/HBY

ZX210K-3G		
Type	Part No	Rod/Buffer
Boom		
Arm	4661661	1051209/HBY
Bucket		

ZX210LC-5G		
Type	Part No	Rod/Buffer
Boom	YA00001396	○851009/HBY
Arm	YA00001400	○951109/HBY
Bucket	YA00001392	○80959/HBY

ZX225-1/E <small>ZX200-3</small>		
Type	Part No	Rod/Buffer
Boom	4448398/4661485	○851009/HBY
Arm	4448399/4661594	○951109/HBY
Bucket	4448400/4654423	○80959/HBY

ZX225LCK <small>ZX200-3</small>		
Type	Part No	Rod/Buffer
Boom	4661661	○1051209/HBY
Arm	4661594	○951109/HBY
Bucket	4411535	

ZX225US-1 <small>ZX200-3</small>		
Type	Part No	Rod/Buffer
Boom	4448398/4661485	○851009/HBY
Arm	4448399/4661594	○951109/HBY
Bucket	4448400/4654423	○80959/HBY

ZX225USR-1		
Type	Part No	Rod/Buffer
Boom	4661485/4448398	○851009/HBY
Arm	4661594/4448399	○951109/HBY
Bucket	4654423/4465493	○80959/HBY

ZX225 USR/US <small>ZX225USR</small>		
Type	Part No	Rod/Buffer
Boom	4448398/4661485	○851009/HBY
Arm	4448399/4661594	○951109/HBY
Bucket	4465493	○851009/HBY

ZX225USRK		
Type	Part No	Rod/Buffer
Boom	4661485/4448398	○851009/HBY
Arm	4661594/4448399	○951109/HBY
Bucket	4654423/4465493	○80959/HBY

ZX225-3 <small>ZX225 US-3</small>		
Type	Part No	Rod/Buffer
Boom	4654421	○851009/HBY
Arm	4654422	○951109/HBY
Bucket	1102306	○80959/HBY

ZX225US-3 <small>ZX225-3</small>		
Type	Part No	Rod/Buffer
Boom	4654421/4661485	○851009/HBY
Arm	4654422	○951109/HBY
Bucket	1102306/4448400	○80959/HBY

ZX225USR-1 <small>ZX225 USR/US</small>		
Type	Part No	Rod/Buffer
Boom	4448398/4661485	○851009/HBY
Arm	4661594/4448399	○951109/HBY
Bucket	4654423/4465493	○851009/HBY

ZX225USR-3 <small>ZX225-3</small>		
Type	Part No	Rod/Buffer
Boom	4654421/4661485	○851009/HBY
Arm	4654422	○951109/HBY
Bucket	1102306/4448400	○80959/HBY

ZX230/240/250 NABCO		
Type	Part No	Rod/Buffer
Boom	4485612	○IUY901059/HBY
Arm	4485613	○IUY1051209/HBY
Bucket	4485614	○IUY901059/HBY

ZX230/240/250 DYM Type		
Type	Part No	Rod/Buffer
Boom	9207060	○IUY901059/HBY
Arm	9207059	○IUY1051209/HBY
Bucket	4485614	○IUY901059/HBY



ZX230-1		ZX250-3
Type	Part No	Rod/Buffer
Boom	9207058	—
Arm	9207059	1001159/HBY
Bucket	9207060	○IU901059/HBY

ZX230-3		ZX240-3 same
Type	Part No	Rod/Buffer
Boom	4650419	○901059/HBY
Arm	4649050	○1051209/HBY
Bucket	4650433	○901059/HBY

ZX240		ZX200-3/ZX200-7
Type	Part No	Rod/Buffer
Boom	4448398/4661485	○851009/HBY
Arm	4448399/4661594	○951109/HBY
Bucket	4448400/1102306	○80959/HBY

ZX240-1		ZX200-6/ZX200-7
Type	Part No	Rod/Buffer
Boom	4448398/4654421	○851009/HBY
Arm	4448399/4654422	○951109/HBY
Bucket	4448400/1102306	○80959/HBY

ZX240-3		ZX230-3 same
Type	Part No	Rod/Buffer
Boom	4650419	○901059/HBY
Arm	4649050	○1051209/HBY
Bucket	4650433	○901059/HBY

ZX250-3/ZX250H-3		ZX240-3
Type	Part No	Rod/Buffer
Boom	4650419	○901059/HBY
Arm	4649050	○1051209/HBY
Bucket	4650433	○901059/HBY

ZX250-3		ZX230-1
Type	Part No	Rod/Buffer
Boom	9207058	—
Arm	9207059	○1001159/HBY
Bucket	9180580/9207060	○901059/HBY

ZX250H-5A		耐熱材料
Type	Part No	Rod/Buffer
Boom	YA00006590	○901059/HBY
Arm	YA00006591	○1051209/HBY
Bucket	YA00006592	○901059/HBY

ZX250LCH-5		耐熱材料
Type	Part No	Rod/Buffer
Boom	YA00006590	○901059/HBY
Arm	YA00006591	○1051209/HBY
Bucket	YA00006592	○901059/HBY

ZX250LCK-3		ZX230-1
Type	Part No	Rod/Buffer
Boom	9207058	—
Arm	9207059	○1001159/HBY
Bucket	9180580/9207060	○901059/HBY

ZX260/270/280		NABCO
Type	Part No	Rod/Buffer
Boom	4485615	○IU95/HBY
Arm	4639938	○IU100/HBY
Bucket	4639939/9180580	○IU90/HBY

Type	Part No	Rod/Buffer

ZX260-1		KYB
Type	Part No	Rod/Buffer
Boom	UNKNOWN	—
Arm	9180579	○1001159/HBY
Bucket	9180580	○901059/HBY

NABCO ZX270-1		ZX280-1
Type	Part No	Rod/Buffer
Boom	4485615	○IUH951109/HBY
Arm	4639938	○IUH1001159/HBY
Bucket	4639939	○IUH901059/HBY

ZX270-1 LC		
Type	Part No	Rod/Buffer
Boom	4639936	—
Arm	4639938	○IUH1001159/HBY
Bucket	4639939	○IUH901059/HBY

ZX270-1		ZX280-1
Type	Part No	Rod/Buffer
Boom	UNKNOWN	○951109/HBY
Arm	9180579	○1001159/HBY
Bucket	9180580	○901059/HBY

KYB ZX280-1		ZX270-1
Type	Part No	Rod/Buffer
Boom	UNKNOWN	○951109/HBY
Arm	9180579	○1001159/HBY
Bucket	9180580	○901059/HBY

NABCO ZX280-1		ZX270-1
Type	Part No	Rod/Buffer
Boom	4485615	○IUH951109/HBY
Arm	4639938	○IUH1001159/HBY
Bucket	4639939	○IUH901059/HBY

ZX280-3		
Type	Part No	Rod/Buffer
Boom	4649745	—
Arm	4649752	—
Bucket	4649751	—

ZX330/350/370		NABCO
Type	Part No	Rod/Buffer
Boom	9180581	○IUH1051209/HBY
Arm	9180582	○IUH1151309/HBY
Bucket	9175564/9180832	○IUH951109/HBY

ZX330/350/370		
Type	Part No	Rod/Buffer
Boom	4640107	○10512512/HBY
Arm	4640118	○11513512/HBY
Bucket	4640108	○951109/HBY

ZX330-3/ZX350-3		ZX350-3
Type	Part No	Rod/Buffer
Boom	4649049	○1051209/HBY
Arm	4649051	○1151309/HBY
Bucket	4649053	○951109/HBY

ZX330-5A		
Type	Part No	Rod/Buffer
Boom	4649049	○1051209/HBY
Arm	YA0000659 7	○1151309/HBY
Bucket	YA0000659 8	○951109/HBY

ZX330-5B		
Type	Part No	Rod/Buffer
Boom	YA0000659/4649049	○1051209/HBY
Arm	YA0000659 7	○1151309/HBY
Bucket	YA0000659 8	○951109/HBY

耐熱材 ZX350-1		
Type	Part No	Rod/Buffer
Boom	9180581	○IUH105/HBY
Arm	9180582	○IUH110/HBY
Bucket	9175564	○IUH95/HBY

ZX350-3/ZX330-3		ZX330-3
Type	Part No	Rod/Buffer
Boom	4649049	○1051209/HBY
Arm	4649051	○1151309/HBY
Bucket	4649053	○951109/HBY

ZX350-3		
Type	Part No	Rod/Buffer
Boom	9078845	○1051209/HBY
Arm	9078846	○1151309/HBY
Bucket	9078843	○951109/HBY



EX8-1/2		
Type	Part No	Rod/Buffer
Boom		○25356/-
Arm	UNKNOWN	○25356/-
Bucket		○25356/-

EX8-2B		
Type	Part No	Rod/Buffer
Boom		○25356/-
Arm	UNKNOWN	○25356/-
Bucket		○25356/-

EX12-1/2		
Type	Part No	Rod/Buffer
Boom		○30408/-
Arm	UNKNOWN	○30408/-
Bucket		○30408/-

EX15-1		
Type	Part No	Rod/Buffer
Boom		○35458/-
Arm	UNKNOWN	○35458/-
Bucket		○30408/-

EX15-2		
Type	Part No	Rod/Buffer
Boom		○30408/-
Arm	UNKNOWN	○35458/-
Bucket		○30408/-

EX18-2		
Type	Part No	Rod/Buffer
Boom		○35458/-
Arm	UNKNOWN	○35458/-
Bucket		○30408/-

EX20U-1/2		
Type	Part No	Rod/Buffer
Boom		○35519/-
Arm	UNKNOWN	○406012/-
Bucket		○35519/-

EX20U-3		
Type	Part No	Rod/Buffer
Boom		○40559/-
Arm	UNKNOWN	○40559/-
Bucket		○35458/-

EX20UR-1/2		
Type	Part No	Rod/Buffer
Boom		○406012/-
Arm	UNKNOWN	○40559/-
Bucket		○35458/-

EX20UR-3		
Type	Part No	Rod/Buffer
Boom		○406012/-
Arm	UNKNOWN	○40559/-
Bucket		○35458/-

EX22-1		
Type	Part No	Rod/Buffer
Boom		○406012/-
Arm	UNKNOWN	○406012/-
Bucket		○35519/-

EX22-2		
Type	Part No	Rod/Buffer
Boom		○406012/-
Arm	UNKNOWN	○35519/-
Bucket		○35519/-

EX25-1		
Type	Part No	Rod/Buffer
Boom	4305787	○456512/-
Arm	4293347	○406012/-
Bucket	4305786	○406012/-

EX25-2		
Type	Part No	Rod/Buffer
Boom		○406012/-
Arm	UNKNOWN	○406012/-
Bucket		○35519/-

EX30-1/2		
Type	Part No	Rod/Buffer
Boom	4352341	○456512/-
Arm	4352346/4293347	○406012/-
Bucket	4352350	○406012/-
Swing		○406012/-

EX30U-1		
Type	Part No	Rod/Buffer
Boom	744408	○45609/-
Arm	UNKNOWN.	○40559/-
Bucket	UNKNOWN.	○40559/-

EX30UR-1		
Type	Part No	Rod/Buffer
Boom		○456512/-
Arm	UNKNOWN.	○45609/-
Bucket		○40559/-

EX30UR-2		
Type	Part No	Rod/Buffer
Boom		○45609/-
Arm	UNKNOWN.	○45609/-
Bucket		○40559/-

EX30UR-3		
Type	Part No	Rod/Buffer
Boom		○50659/-
Arm	UNKNOWN.	○40559/-
Bucket		○35458/-

EX33MU-1		
Type	Part No	Rod/Buffer
Boom		○507012/-
Arm	UNKNOWN.	○406012/-
Bucket		○406012/-

EX33U-1		
Type	Part No	Rod/Buffer
Boom		○456512/-
Arm	UNKNOWN.	○406012/-
Bucket		○406012/-

EX35-1/2		
Type	Part No	Rod/Buffer
Boom		○456512/-
Arm	UNKNOWN.	○456512/-
Bucket		○406012/-

EX35U-1		
Type	Part No	Rod/Buffer
Boom		○50659/-
Arm	UNKNOWN.	○45609/-
Bucket		○40559/-

EX40-1		
Type	Part No	Rod/Buffer
Boom		○507012/-
Arm	656714	○507012/-
Bucket		○45609/-

EX40-2/AX40U-4		
Type	Part No	Rod/Buffer
Boom	4368522	○557512/-
Arm	4368527	○507012/-
Bucket	4368532	○45609/-
Swing	4368536	○50659/-

EX40U-1/AX40U-3		
Type	Part No	Rod/Buffer
Boom	654216	○55709/-
Arm	656714	○50659/-
Bucket	658611	○40559/-
	656604	507012/-

EX40UR-1/2		
Type	Part No	Rod/Buffer
Boom		○507012/-
Arm	UNKNOWN.	○456512/-
Bucket		○45609/-



Type	Part No	Rod/Buffer
Boom		
Arm		
Bucket		

耐熱材 ZX370-1		
Type	Part No	Rod/Buffer
BOOM	9180581	○IUH105/HBY
Arm	9180582	○IUH110/HBY
Bucket	9175564	○IUH95/HBY

ZX450(LC)-1/-		
Type	Part No	Rod/Buffer
Boom	4438672	○11513512/HBY
Arm	4438679	○11513512/HBY
Bucket	4438672	○11513512/HBY

ZX450-3		ZX470-1
Type	Part No	Rod/Buffer
Boom	4653040	—
Arm	4653041	—
Bucket	4653042	—

ZX450H		
Type	Part No	Rod/Buffer
Boom	4340620/4438672	○11513512/HBY
Arm	4340621/4438679	○13015012/HBY
Bucket	4438681	○11513512/HBY

ZX470-1/3		ZX450-3
Type	Part No	Rod/Buffer
Boom	4653040	—
Arm	4653041	—
Bucket	4653042	—

ZX500-1		
Type	Part No	Rod/Buffer
Boom	9180582	○IUH1151309/HBY
Arm	4438679	13015012/HBY
Bucket	4391705	—

ZX670-1		
Type	Part No	Rod/Buffer
Boom	4653041	—
Arm	4652905	—
Bucket	4652906	—

Type	Part No	Rod/Buffer
Boom		
Arm		
Bucket		

ZX670-3		
Type	Part No	Rod/Buffer
Boom	4653041	—
Arm	4438684	—
Bucket	4653041	—

ZX850-1		
Type	Part No	Rod/Buffer
Boom	4438684	—
Arm	4436496	—
Bucket	4438693	—

ZX870-3		
Type	Part No	Rod/Buffer
Boom	4653861	—
Arm	4653862	—
Bucket	4653861	—

Type	Part No	Rod/Buffer
Boom	4653040	—
Arm	4653041	—
Bucket	4653042	—

Type	Part No	Rod/Buffer
Boom	4438672	○11513512/HBY
Arm	4438679	○11513512/HBY
Bucket	4438672	○11513512/HBY

Type	Part No	Rod/Buffer
Boom	4653040	—
Arm	4653041	—
Bucket	4653042	—

Type	Part No	Rod/Buffer
Boom	9180582	○IUH1151309/HBY
Arm	4438679	13015012/HBY
Bucket	4391705	—

Type	Part No	Rod/Buffer
Boom	4653041	—
Arm	4652905	—
Bucket	4652906	—

Type	Part No	Rod/Buffer
Boom		
Arm		
Bucket		

Type	Part No	Rod/Buffer
Boom	4653041	—
Arm	4438684	—
Bucket	4653041	—

Type	Part No	Rod/Buffer
Boom	4438684	—
Arm	4436496	—
Bucket	4438693	—

Type	Part No	Rod/Buffer
Boom	4653861	—
Arm	4653862	—
Bucket	4653861	—

Type	Part No	Rod/Buffer
Boom	4653040	—
Arm	4653041	—
Bucket	4653042	—

Type	Part No	Rod/Buffer
Boom	4438672	○11513512/HBY
Arm	4438679	○11513512/HBY
Bucket	4438672	○11513512/HBY

Type	Part No	Rod/Buffer
Boom	4653040	—
Arm	4653041	—
Bucket	4653042	—

Type	Part No	Rod/Buffer
Boom	9180582	○IUH1151309/HBY
Arm	4438679	13015012/HBY
Bucket	4391705	—

Type	Part No	Rod/Buffer
Boom	4653041	—
Arm	4652905	—
Bucket	4652906	—

Type	Part No	Rod/Buffer
Boom		
Arm		
Bucket		